
## 54-6114 Removing and installing function display (ASD, ASR and 4MATIC)

Preceding work: Instrument cluster removed (54–6015). Speedometer removed (54–5320). Operation no, of operation texts and work units or standard texts and flat rates:

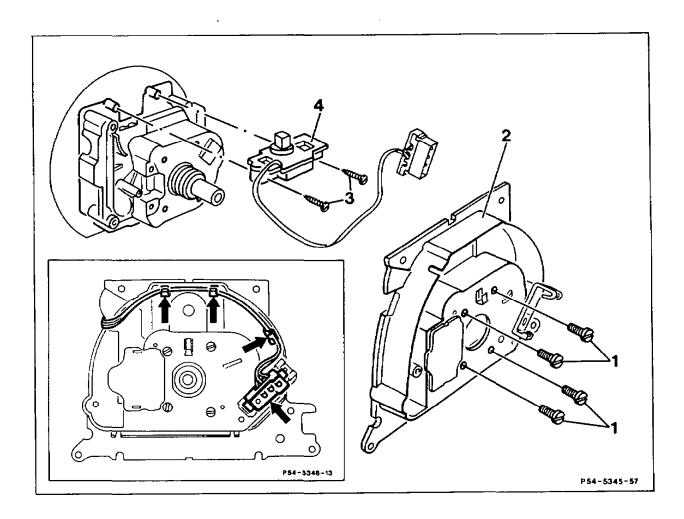

Coupling with cable (arrows)	unclip, clip into place.
Screws (1)	unscrew, screw in.
Housing (2)	take off, insert.
Screws (3)	unscrew, screw in.
Function display (4)	take out, insert.